

This Technical Advisory describes an issue which may or may not affect the customer's product

# **Intel Technical Advisory**

TA-0977-2

5200 NE Elam Young Parkway Hillsboro, OR 97124

September 1<sup>st</sup>, 2011

# The SGPIO cable incompatibility with Intel® SAS Entry Raid Module AXX4SASMOD, Intel® Integrated RAID Module RMS2AF040 and Intel® Integrated RAID Module RMS2LL040

Information in this document is provided in connection with Intel products. No license, express or implied, by estoppel or otherwise, to any intellectual property rights is granted by this document. Except as provided in Intel's Terms and Conditions of Sale for such products, Intel assumes no liability whatsoever, and Intel disclaims any express or implied warranty, relating to sale and/or use of Intel products including liability or warranties relating to fitness for a particular purpose, merchantability, or infringement of any patent, copyright or other intellectual property right. Intel products are not intended for use in medical, life saving, or life sustaining applications. Intel may make changes to specifications and product descriptions at any time, without notice. The Intel products described herein may contain design defects or errors known as errata which may cause the product to deviate from published specifications. Current characterized errata are available on request.

## **Products Affected**

Table, 1. Products Affected

| Product                                       | Product code   | MM#    |
|---|----------------|--------|
| Intel <sup>®</sup> Server System R1304BTLSHBN | R1304BTLSHBN   | 911688 |
|   | R1304BTLSHBNNA | 907658 |
| Intel <sup>®</sup> Server System P4304BTLSHCN | P4304BTLSHCN   | 912775 |
|   | P4304BTLSHCNNA | 907886 |
| Intel <sup>®</sup> Server Chassis P4304XXSHCN | P4304XXSHCN    | 911765 |
|   | P4304XXSHCNNA  | 907812 |

# Description

Intel has discovered the SGPIO cable compatibility issue between some modules and the backplane in the system or the chassis listed above.

The affected modules are Intel<sup>®</sup> SAS Entry Raid Module AXX4SASMOD, Intel<sup>®</sup> Integrated RAID Module RMS2AF040, and Intel<sup>®</sup> Integrated RAID Module RMS2LL040.

Without the SGPIO cable, the fault LED function on the backplane will not be supported on the RAID mode with the affected modules.

Copyright © 2011 Intel Corporation.

\* Other names and brands may be claimed as the property of others.

### **Root Cause**

The SGPIO connector on the backplane in the system or the chassis listed above is a 5-pin connector. The SGPIO connector on the affected module is a 4-pin connector. The cable shipped with Intel® Server System R1304BTLSHBN is a 5-pin to 5-pin cable with IPN number: E98573-001. The cable shipped with Intel® Server System P4304BTLSHCN or Intel® Server Chassis P4304XXSHCN is a 5-pin to 5-pin cable with IPN number: G22461-002. The SGPIO cable is used to connect the Intel® Server Board S1200BTL and the backplane, but not compatible with the affected modules.

### **Corrective Action / Resolution**

Intel has designed one cable (G10943-001) to support the connection between the affected modules and the backplane in Intel<sup>®</sup> Server System R1304BTLSHBN.

Intel has designed one cable (G22461-003) to support the connection between the affected modules and the backplane in Intel<sup>®</sup> Server System P4304BTLSHCN or Intel<sup>®</sup> Server Chassis P4304XXSHCN.

Please contact Intel using your normal warranty process and provide the product code to obtain the SGPIO cable according to the system. Intel will provide you the correct cable based on the product code you provide.

Please indicate you are calling regarding TA-0977-02, and have the following information when you call: serial number(s) for the system(s) needing the replacement part.

Please contact your Intel Sales Representative if you require more specific information about this issue.

Enterprise Platforms & Services Division Intel Corporation