



BIOS Update Release Notes

PRODUCTS: DQ43AP (Standard BIOS)

BIOS Version 0033 - APQ4310H.86A.0033.2010.0208.1456

About This Release:

- February 8, 2010
- ME Firmware: 5.1.10.1175
- MEBx Code: Based on Version 5.1.0.0019
- Integrated Graphics Option ROM: Build 1940
- LAN Option ROM: Intel UNDI,PXE-BA1327L2.LOM

New Fixes/Features:

- Modified Video Configuration > Primary Video Adaptor behavior:
 - Auto: Set priority to PCIEx16, PCIEx1, PCI, IGD
 - Ext PCIe Graphics (PEG): Pick up x1 video if no PCIEx16
- Updated VBIOS to build 1940

BIOS Version APQ4310H.86A.0031.2009.1125.1945

About This Release:

- November 25, 2009
- ME Firmware: 5.0.10.1175
- MEBx Code: Based on Version 5.1.0.0019
- Integrated Graphics Option ROM: Build 1800
- LAN Option ROM: Intel UNDI,PXE-BA1327L2.LOM

New Fixes/Features:

- Fixed issue where PS/2 mouse does not work if a PS/2 keyboard is not attached.
- Implemented security phase 2 patch.
- Modified iQST payload to fix issue where MCH voltage gauge is shown incorrectly in Intel® Desktop Utilities.

BIOS Version APQ4310H.86A.0029.2009.1103.2043

About This Release:

- November 3, 2009
- ME Firmware: 5.0.10.1175
- MEBx Code: Based on Version 5.1.0.0019
- Integrated Graphics Option ROM: Build 1800
- LAN Option ROM: Intel UNDI,PXE-BA1327L2.LOM

New Fixes/Features:

- Changed the default setting of Intel Virtualization Technology to Enable.
- Added feature where after changes are made to VT-related features, upon exit of BIOS, the system will go to S5 then wake and restart.
- Fix issue where WHQL Signed Driver Check failed.

*Other names and brands may be claimed as the property of others.

- Fixed POST 51 error when using certain wireless keyboard.
- Fixed issue where S3 resume time is greater than 2 seconds.

BIOS Version 0028

About This Release:

- August 21, 2009
- APQ4310H.86A.0028.2009.0821.1656
- ME Firmware: 5.0.3.1175
- MEBx Code: Based on Version 5.1.0.0019
- Integrated Graphics Option ROM: Build 1800
- LAN Option ROM: Intel UNDI,PXE-BA1327L2.LOM

New Fixes/Features:

- Fixed issue where PS/2 mouse does not work if a PS/2 keyboard is not attached.
- Added a workaround for SCCM SOL hang at CP 50 issue.
- Updated to automatically detect floppy diskette device by SIO GP22.
- Changed processor fan DutyCycleMin from 40% to 20%.
- Fixed issue where chassis outlet fan does not get detected properly.
- Updated Video BIOS to version 1800.
- Fixed issue related to S3 resume time less than 2 seconds.

BIOS Version 0027

About This Release:

- July 28, 2009
- APQ4310H.86A.0027.2009.0728.2103
- ME Firmware: 5.0.3.1175
- MEBx Code: Based on Version 5.1.0.0019
- Integrated Graphics Option ROM: Build 1744
- LAN Option ROM: Intel UNDI,PXE-BA1327L2.LOM

New Fixes/Features:

- Implemented updates to improve security.
- Updated Intel® ME FW to 5.1.10.1175 and MEBX to 5.1.0.0019.
- Fixed "SMBIOS System Slot Information" and "MOSTEST-Microsoft OEM String" error.
- Fixed Chassis Intrusion Log Only issue.
- Fixed issue where Optical device disable causes Boot Device Priority to show two floppy drives.
- Fixed issue where low speed 4-wire fan detects incorrectly.
- Fixed BIOS Setup Compliance test fail with UQI 0066 and UQI 03B5 error.
- Fixed issue where S3 fails on Linux platforms.
- Fixed issue where Wake-on-LAN fails after G3 to S5.
- Fix issue where PATA hard drive information will show at SATA port.
- Fixed issue where floppy drive controller appears in Device Manager.
- Updated iQST feature.
- Updated fonts in POST and Setup.
- Fixed issue where processor and SMBIOS do not display correctly.

*Other names and brands may be claimed as the property of others.

- Fixed issue where card reader CF card does not boot properly.
- Fixed issue where when changing Primary Video Adaptor to Int Graphics (IGD) and plugging in a PCI VGA card, the PCI VGA card driver cannot be installed.

BIOS Version 0024

About This BIOS:

- April 10, 2009
- APQ4310H.86A.0024.2009.0410.1430
- VBIOS Version: 1744
- GBE firmware bin version: 0.5
- PXE Option Rom file: Intel UNDI,PXE-BA1327L2.LOM
- MEBx Version: 5.0.5.0010
- ME Version: 5.0.3.1126

New Fixes/Features:

- Initial production BIOS release

LEGAL INFORMATION

Information in this document is provided in connection with Intel Products and for the purpose of supporting Intel developed server/desktop boards and systems.

No license, express or implied, by estoppel or otherwise, to any intellectual property rights is granted by this document. Except as provided in Intel's Terms and Conditions of Sale for such products, Intel assumes no liability whatsoever, and Intel disclaims any express or implied warranty, relating to sale and/or use of Intel products including liability or warranties relating to fitness for a particular purpose, merchantability, or infringement of any patent, copyright or other intellectual property right. Intel Corporation may have patents or pending patent applications, trademarks, copyrights, or other intellectual property rights that relate to the presented subject matter. The furnishing of documents and other materials and information does not provide any license, express or implied, by estoppel or otherwise, to any such patents, trademarks, copyrights, or other intellectual property rights. Intel products are not intended for use in medical, life saving, or life sustaining applications. Intel may make changes to specifications and product descriptions at any time, without notice.

Intel is a trademark of Intel Corporation in the US and other countries.
Copyright (c) 2008 Intel Corporation.